

# MONUMENT RECORD

Corner I.D. #

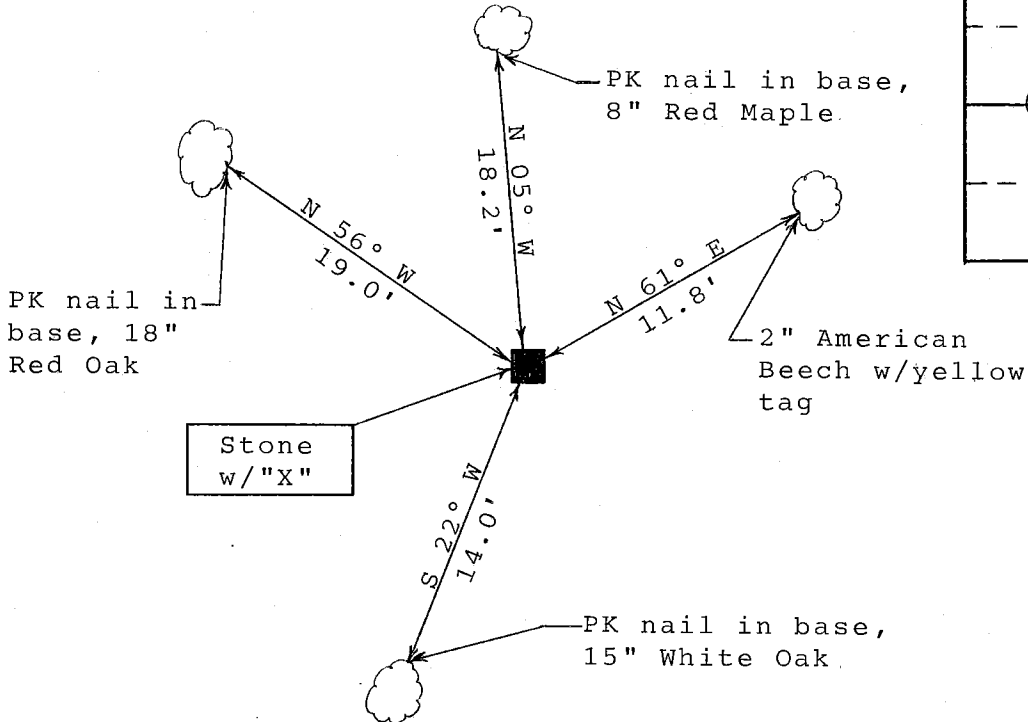
R-11 R-35

STATE OF INDIANA - COUNTY OF MONROE

Section Fourteen (14), Township 9 North, Range 1 East

Monument Description & Remarks: Stone found w/"X" at SW corner of E 1/2 of NW 1/4. Stone was laying on its side. Corner witnessed 6/30/89. (See attached notes)

Recovery Tie Drawing



● At Corner



Not To Scale

State of Indiana  
County of Monroe

I, Michael W. Friley, County Surveyor; *M.W.F.* hereby certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319; and the above data is given under my hand and seal this 1st day of February, 1995 A.D.

Space  
Reserved For  
Recording  
Officer

Indiana Registered Land Surveyor No. \_\_\_\_\_ or

Morgan-Monroe State Forest

United States Government Agency

Darrell Breedlove, Timber Specialist

Title

Field Book:

n/a

Page:

n/a


## SECTION 14, T 9 N, R 1 E

rebar (see 3f)


1. On 6/26/87, the west line of the E $\frac{1}{2}$ , NW $\frac{1}{4}$  was ran by compassing north from a pipe found at the SW corner, E $\frac{1}{2}$ , NW $\frac{1}{4}$ . A stone was located at the NW corner, E $\frac{1}{2}$ , NW $\frac{1}{4}$  and it was witnessed as follows:

	Az <sup>o</sup>	Species	DBH	Distance
44 <sup>o</sup> -W	224	Shagbark Hickory	18"	20.1'
62 <sup>o</sup> -E	062	Am. Beech	23"	22.8'
26 <sup>o</sup> -E	026	Am. Beech	14"	15.9'

The bearing between the two markers is N 0.8E at 1°W declination. Plastic signs were posted at the stone.

  
Darrell Breedlove  
Timber Specialist

2. On August 17, 1988, a steel fence post was driven next to the stone at NW corner, E $\frac{1}{2}$ , NW $\frac{1}{4}$ , Sec. 14.

  
Darrell Breedlove  
Timber Specialist

- 3a) On June 29, 1989, the South  $\frac{1}{4}$  mile stone of the SW $\frac{1}{4}$ , Sec. 14, T9N, R1E was witnessed as follows:

PK nails were driven at the bases of these trees:

	AZ	Spp.	DBH(in)	Distance(ft)	Comment	
N-76 <sup>o</sup> -E	076 <sup>o</sup>	Sugar Maple	28	13.8	Hollow w/wire	3
S-07 <sup>o</sup> -W	187	Basswood	19	20.8	w/wire	
S-33 <sup>o</sup> -W	213	Sugar Maple	2	11.0		
N-63 <sup>o</sup> -W	297	Red Elm	6	1.8	Dead tree in fence corner	

This stone has an "x" and measures 4"x8"x1"(h). It is S 0.9°E (1°W) from the SW corner, E $\frac{1}{2}$ , NW $\frac{1}{4}$ , Sec. 14 (see 3b).

- b) On June 30, 1989, the SW corner, E $\frac{1}{2}$ , NW $\frac{1}{4}$ , Sec. 14 was witnessed as follows: PK nails were driven at the bases of the first three trees.

	AZ	Spp.	DBH(in)	Distance(ft)	Comment	
S-22 <sup>o</sup> -W	202 <sup>o</sup>	White Oak	15	14.0		
<del>S-33<sup>o</sup>-W</del>	304	Red Oak	18	19.0	N 56° W	
N-05 <sup>o</sup> -W	355	Red Maple	8	18.2		
N-61 <sup>o</sup> -E	61	American Beech	2	11.8	Has yellow tag	

this stone is laying on its side, but it has an "x".

- c) Two pipe markers were observed in the vicinity of the center of the SW $\frac{1}{4}$ , Sec. 14, but neither marker is on-line between two stones found (see 3a and 3b). A  $\frac{1}{2}$ "x10"